

STEVAL-ISW001V1 2.5 kW/135 A MMA welding machine

Introduction

The STEVAL- ISW001V1 is a 2.5 kW welding machine capable of 135 A of welding current. It is designed for small industrial applications and domestic use in many DIY applications. The machine is ready-to-use and designed to implement the Manual Metal Arc (MMA) welding process and to weld iron and steel following MMA process recommendations.

The board is intended for demonstration purposes in order to evaluate the potential of silicon devices on high power/current applications where the robustness/efficiency of the silicon part is the key point for a reliable system.


The whole system is made up of two boards. A power board, where all the power devices involved in the power conversion are fitted, and a small control board, which includes a PWM generator and an analog control circuitry necessary to manage the MMA welding process.

The design is:

- Quick to set up and install
- Re-usable (the Gerber files are available free)
- Ready to downsize if required

Note: Please read the safety and operating instructions section before attempting any operation with this manual. Further technical and theoretical information on this board can be found in the application note AN3200; 2.5 kW MMA welding machine.

Figure 1. Typical low-end welding machine topology

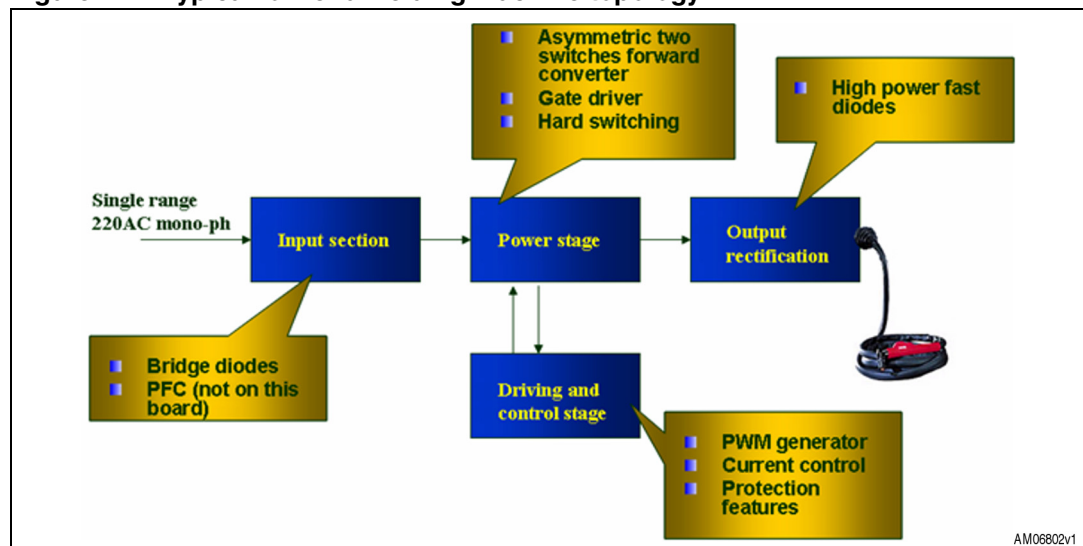

Contents

1	Board description	4
2	Safety and operating instructions	5
2.1	General	5
2.1.1	2.5 kW/135 A welding machine use	5
2.2	2.5 kW/135 A welding machine installation	5
2.2.1	Electronic connection	6
2.2.2	2.5 kW/135 A welding machine demonstration setup	6
2.3	Hardware layout	7
2.4	Environmental and equipment considerations	8
2.5	2.5 kW/135 A welding machine board connection	8
2.6	STEVAL-ISW001V1 main description	9
2.7	STEVAL-ISW001V1 circuital description	10
2.8	IGBT or power MOSFET compatibility	12
3	Schematics	13
4	Revision history	15

List of figures

Figure 1. Typical low-end welding machine topology 1

Figure 2. 2.5 kW/135 A welding machine STEVAL-ISW001V1 top view 7

Figure 3. Power board schematic diagram 13

Figure 4. Control board schematic diagram 14

1 Board description

This demonstration board represents a good starting point and a ready platform for a more complete and dedicated system, even though it cannot be considered an industrial standard welding machine and therefore is not for professional use. A particular method of implementing welding current sensing is present on the board and patented. Thanks to the cooperation of Magnetica, some magnetic components have been designed and optimized for this application. All these components are orderable through Magnetica.

The layout of the power board has been optimized to have a low level of interference, considering the power delivered and the current level present on many parts of the board.

Also the rectangular shape of the board and the position of the magnetic/silicon devices were considered in order to guarantee a sufficient air flux on the parts which are more involved in heat dissipation. An air fan is necessary for safe and reliable system use at all times.

The board includes:

- An input stage composed of a 25 A power rectifier bridge
- An input filter stage necessary for compliance with EMC emission levels
- A small analog control daughter board (operational-amplifier TSM102 and SG3525 PWM generator)
- A power stage made up of a power IGBT or MOSFET and power ultrafast diodes.
- A ferrite power high frequency transformer designed and manufactured for this application
- An output free air inductor with an auxiliary winding needed to implement the patented output current sensing.

2 Safety and operating instructions

2.1 General

During assembly and operation the 2.5 kW/135 A welding machine demonstration board poses several inherent hazards including bare wires and hot surfaces. If the board or its components are improperly used or installed incorrectly there is a danger of serious personal injury and damage to property.

All operations involving transportation, installation, and use, as well as maintenance, are to be carried out by skilled technical personnel (national accident prevention rules must be observed). For the purposes of these basic safety instructions, "skilled technical personnel" are considered to be suitably qualified people who are familiar with the installation, use, and maintenance of power electronic systems.

Warning: Many sources of serious danger are present on this board. The board works directly from the mains and the input power stage is not galvanic insulated. The ground of the control/power system is not insulated from the mains and could be a cause of electric shock, burns, or death. Hot surfaces, capable of causing serious burns, are present on the board. This board must be used only in a power laboratory and only by engineers and technicians who are experienced in power electronics technology and under the proper protection. STMicroelectronics is not responsible for the safety of the user or for any damage caused.

2.1.1 2.5 kW/135 A welding machine use

The 2.5 kW/135 A welding system is designed for demonstration purposes only and is not intended for professional use, industrial manufacturing, or to be used as part of industrial machinery. It is neither in production nor an industrial project. Conformity to safety rules and standards needs to be monitored. The technical data, as well as information concerning the supply conditions, must be taken from the correct documentation and strictly observed.

2.2 2.5 kW/135 A welding machine installation

The installation and cooling of the 2.5 kW/135 A welding machine is in accordance with the specifications and the targeted application (see [Section 2.2.2: 2.5 kW/135 A welding machine demonstration setup](#)).

- Excessive strain on the board should be avoided. In particular, no components are to be bent, or isolating distances altered, during transportation or handling
- No contact should be made with electronic components and contacts
- Do not put the heatsinks together in electric contact
- The heatsinks are not electrically insulated from high voltage potential. There is a danger of electric shock present.

Electrical components must not be mechanically damaged or destroyed (in order to avoid potential health risks).

2.2.1 Electronic connection

National accident prevention rules must be followed when working on the main power supply with the power supply or power board in general.

The electrical installation is completed in accordance with the appropriate requirements (e.g., cross-sectional areas of conductors, fusing, or PE connections; for further information see [Section 2.2.2](#)).

2.2.2 2.5 kW/135 A welding machine demonstration setup

Special attention must be paid when setting a bench test to show the operation of the 2.5 kW/135 A welding machine.

This is a complete welding machine design, equipped with an analog welding logic control, so also a real and practical welding process may be demonstrated.

- Two options are available to startup the board.
 - working on a resistive dummy load
 - welding of real pieces of iron/steel

The first option (a resistive dummy load) is suggested if the user is not skilled in the welding process. A suitable load is needed. Generally the plasma arc, responsible for metal arc welding (in the case of iron or steel welding), can be modeled as follows (from the standard regulation for MMA welding):

$$V_{\text{arc}} = 20 + 0.04 \times I_{\text{arc}} \quad (\text{representative of the peak voltage across the arc})$$

From this, assuming a welding current of 100 A is imposed, the output of the system is about 24 V. The calculation of the equivalent resistive dummy load is:

Equation 1

$$R_{\text{arc}} = \frac{V_{\text{arc}}}{I_{\text{arc}}} = \frac{24}{100} = 0.24 \Omega$$

A resistor, capable of dissipating the maximum power delivered by the machine (2.5 kW), in a range of resistance between 0.2 and 0.3 Ω , can be used. In this case a valid cooling system (fan or water) should be used to diffuse the heat dissipated by the resistor.

For the second option, it is sufficient to connect a suitable clamp (available in most specialized outlets, though not included in the demonstration package) to the negative output of the board, through a cable not longer than 2 m and with a cross section not less than 16 mm². Connect a suitable welding torch to the positive output, also using, in this case, a cable with the same characteristics as for the negative connection. Once the clamp is fixed to the iron sample, it is possible to start welding. A dedicated environment should be considered for the demonstration. The demonstration must be carried out by persons skilled in the arc welding process. The demonstration of a welding process can be dangerous to the work environment or cause fire, due to the numerous incandescent sparks created by the plasma arc. The work environment needs sufficient ventilation to assure the dispersion of smoke caused by rod and metal fusion. Any person involved in the operation must wear protective clothing, compliant with relevant accident prevention rules.

In any case, avoid contact with metallic parts during welding and for some minutes after. The welding process creates high temperatures to fuse the metal and therefore there is a risk of serious burns.

Do not leave the rod unattended just after the welding operation. The tip of the rod remains incandescent for some minutes and can be a cause of fire, damage to the environment, or personal harm.

The welding process starts by putting the rod in contact with the metal sample connected to the negative output through the clamp, supplied by the positive output of the board. Do not directly touch the rod or the metal piece, the output voltage, at open load, can cause electric shock.

An AC which is insulated and protected against overload and short-circuit is preferable to be used during the evaluation test of the 2.5 kW/135 A welding machine.

In case of a resistive and dissipative dummy load, attention should be paid to the temperature that the load could reach. The required equipment must be provided in order to avoid hot surfaces and fire risk during the tests (fan, water cooled load, etc.).

Note: Do not touch the board and its components after disconnection from the voltage supply, as several parts and power terminals, which may contain energized capacitors, need to be allowed to discharge.

2.3 Hardware layout

Figure 2. 2.5 kW/135 A welding machine STEVAL-ISW001V1 top view



The main input connector can be seen on the left-hand side in the image, near the fuse connector. Connect a sinusoidal supply voltage with an amplitude in the range of between 185 VAC_{rms} to 265 VAC_{rms} or a DC voltage between 310 Vdc and 375 Vdc. The power source must be able to supply the power required by the system, according to the welding current required on the output. The two output connectors are present on the right-hand side (close to the output free air inductor). On the centre of the board the ferrite high frequency power transformer, made up of the double switch forward converter, can be found. The two big heatsinks on the left-hand side are sized to allow power dissipation of the four power

switches. The heatsink on the right-hand side allocates the output fast power diodes. In the bottom end of the image, the control board, fitted by a strip connector, is visible. An external potentiometer is present to set the welding current according to the metal pieces to be welded. On the control board two small trimmers are present. Read the circuit description in [Section 2.7](#) carefully for information about the function and how to trim them. A trimmer is present on the power board near the output inductor. Read the circuit description in [Section 2.7](#) carefully for information about the function and how to trim it.

Warning: The STEVAL-ISW001V1 has no insulation shield or any other type of protection case. The demonstration board must be handled very carefully, as high potential (energy) parts are exposed and may be touched. The user **MUST** avoid connecting or removing cables during operation of the board, or touching any part of the system when it is connected to the main power supply.

Note: After turning the power supply off, if the load is disconnected, the DC-link capacitor may still hold a voltage.

It is preferable to test the kit in an ambient temperature not higher than 45 °C.

2.4 Environmental and equipment considerations

Read the recommendations in [Section 2.2.2](#) carefully for environmental considerations.

Also, in the case of testing on a resistive dissipative dummy load, the STEVAL-ISW001V1 must only be used in a power laboratory equipped with a ventilation system or smoke extractor fan system. The high voltage involved in the system presents a serious danger of shock. If your purposes consist in measurement or waveform acquisition, or any other interaction between the board and laboratory equipment, an AC insulated power supply must be used.

Note: Any measurement equipment must be isolated from the main power supply before powering up the system. If using an oscilloscope with the kit, it is safer to isolate the AC supply AND the oscilloscope, or use insulated differential probes. This prevents shock occurring as a result of touching any SINGLE point in the circuit but does NOT prevent shock when touching TWO or MORE points in the circuit.

An isolated AC power supply can be constructed using an isolation transformer and a variable transformer (isolating the application rather than the oscilloscope is highly recommended in any case).

2.5 2.5 kW/135 A welding machine board connection

The welding machine demonstration board comes ready-to-use and is made up of two boards. A power board and a control board. The control board is a small daughter board connected to the power board through a strip-line connector. A small insulated auxiliary power supply based on the VIPer16L is allocated to the power board. The auxiliary power supply is used to generate all the low voltage supplies needed by the control board and the gate driving section on the power board. In particular a +5 V, +15 V, and an insulated +15 V

are generated. On the board there is a jumper marked “aux_supply_selection” that allows the supply, through a separated external source, of the auxiliary power supply on the board. When setting the jumper in position 1, the DC supply must be provided by an external DC source capable of a minimum of 45 V (lower voltages do not assure the functioning of the VIPer16 section) and a minimum current of at least 50 mA. When setting the jumper aux_supply_selection to position 2, the DC source to the VIPer16 is directly the high voltage bus available on the power board.

The possibility to use an independent voltage source, allows the control part to be tested or to see some waveforms without supplying the power part. It can also be useful to supply the power part with a lower voltage than the nominal in order to work in safe conditions.

Connect the board to the AC power supply (see [Section 2.4](#) and [Section 2.2.2](#)).

Use a suitable cable, in terms of insulation and cross section, to be able to conduct the current from the AC power supply according to the maximum power of the application.

Note: *The control system has a sensing of the output voltage delivered to identify a shortcut condition during hot start or the welding phase. Supplying the power source with a limited or out of nominal range voltage value can trigger this protection limiting the duty cycle. See the circuit description ([Section 2.7](#)) to have information on how to disable this function. Supply the welding machine board with a sinusoidal supply voltage with amplitude in the range between 185 Vrms to 265 Vrms, or with a DC voltage between 310 Vdc and 375 Vdc. The power source must be able to supply the power required by the system, according to the welding current set.*

Note: *Do not supply the system with a voltage value higher than 265 Vrms, there is a risk of serious damage to the board and to property in this case. Do not supply the system with a voltage below the minimum allowed, 185 Vrms, the system may not operate properly in this condition.*

Note: *A low voltage supply and maximum output load is the worst working condition for the system, in this condition good cooling is mandatory.*

2.6 STEVAL-ISW001V1 main description

The STEVAL-ISW001V1 demonstration board, developed by STMicroelectronics, provides a ready-to-use demonstration solution for the implementation of an MMA welding machine. The board can be used for demonstration purposes but is not, however, optimized for industrial use or production machinery.

STMicroelectronics has patented a solution to improve the out-current control of the machine without the use of a shunt resistor on the output. A simple analog circuit reconstructs the current on the output using the input peak current on the primary side of the insulation transformer as the input parameter and the reflected welding voltage on the output inductor.

The current control also implements certain basic functions for good welding performance.

A hot start function improves the heating phase of the rod, during the initial contact with the metal piece, which allows an immediate arc firing and a short-circuit time to be obtained.

Short-circuit protection drastically reduces the output current after 2 seconds, in case the arc extinguishes and the consequent sticking of the welding rod. Thermal protection is also

implemented using two ceramic thermostats, one mounted on the power switches heatsink and one on the output power diodes heatsinks.

- Features
 - Welding machine based on asymmetric forward double switch converter
 - Power stage based on IGBT or MOSFET
 - $185 \text{ VAC}_{\text{rms}} < \text{VINAC}_{\text{rms}} < 265 \text{ VAC}_{\text{rms}}$
 - $I_{\text{out max}} 135$, regulated from 50 A
 - Auxiliary flyback power supply based on the VIPer16
 - L6386E gate driver
 - Analog control based on the TSM102 op amps + comparators
 - Output short-circuit protection
 - Hot start function

2.7 STEVAL-ISW001V1 circuital description

In [Figure 3](#) the electronic schematic of the power board is shown.

Starting from the main supply input, a common mode filter and a power diode bridge can be found. After the bridge, a DC bus, filtered by the electrolytic capacitor C35 and C36, is available.

The auxiliary power supply, based on the VIPer16, is based on a flyback topology and can supply two galvanic insulated low voltage supplies. One of these two low voltage sources is connected to the common ground and used to supply all the logic and analog circuit present on the control board, plus the gate driver. The insulated output (+15 V) is used to supply the bootstrap section of the L6386 driver. In this way, a safe high side supply is assured.

The gate driver section is based on the L6386 chip. Using the internal comparator of the L6386, also a hardware current protection has been implemented. The current, on the primary side of the insulation transformer, measured by the current transformer on the power board, after a partition through R48 and R49, is connected to pin 6. Pin 6 (Cin) is the input of the internal comparator. If the voltage level on this pin rises to 0.5 V, the comparator triggers, pulling down the DIAG pin. This pin is connected to the pin shutdown of the driver, so a valid and fast current protection is implemented. In order to have a good current capability and noise immunity on the gate of the power switches, the two outputs of the driver (Hvg and Lvg) are buffered by two push-pulls. Two STS01DTP06s are used for this purpose. The expected maximum peak current on the primary side is about 45 A at 135 A at welding current. In these conditions two paralleled power switches are required. Two ultra fast power diodes D25 and D32 are used to freewheel the magnetization current of the transformer during the T_{OFF} of the PWM. For this reason the maximum duty cycle cannot surpass 50 % on this topology.

The power rectifier can be found on the secondary side of the power transformer made up of ultra fast power diodes. An insulated sensing of the output voltage is implemented to identify a short-circuit condition. In fact, during a normal arc condition a voltage between 18 and 25 V should be present on the output. The optocoupler senses the output voltage and gives information to the control board. The trimmer R60 is useful to set a proper voltage threshold to the optocoupler according to length and cross section of the cable used to connect the board to the torch and clamp.

In [Figure 4](#) the electronic schematic of the control board is depicted.

- Three basic blocks can be identified in the schematic of the welding machine control board:
 - Analog amplification and computation block based on the TSM102
 - PWM generator based on the SG3525
 - Welding current dynamic reference based on discrete components

The analog amplification and computation block are based on the TSM102. This chip has two operation amplifiers, two voltage comparators, and a voltage reference inside. The operational amplifiers are used to implement an analog current control made up of a PID and an integrator. The working principle is well described and explained in the application note dedicated to the welding machine system (see AN3200; *2.5 kW MMA welding machine*).

One of the two amplifiers is used to implement the error amplifier for the current control. A voltage representative of the output welding current is subtracted to a voltage level representative of the wanted target current level. The error signal is amplified and represents the PWM level to be set as the control variable to the power converter.

This is a standard PID control.

The measurement of the output current is obtained by an indirect estimation. By measuring only the peak current on the primary side of the power insulation transformer, information on the peak current at the output is obtained, following the relation between the primary and secondary turn number on the windings.

To obtain information regarding the mean current on the load, information regarding the current ripple on the output inductor is required. This information can be obtained by acquiring the voltage reflected to the output inductor and integrating this information. (For a more detailed explanation and mathematical model see the AN3200 application note dedicated to the MMA welding machine. The last block is dedicated to giving the right target to the current control, according to the MMA process status. In particular, two trimmers can be found on the control board. The welding current setup trimmer and the short-circuit current setup trimmer. The trimmer dedicated to setting the welding current is also replicated on the power board in order to be free to solder three wires, and to position the trimmer on the front panel of the welding machine for easy setting during the work.

The second trimmer, is dedicated to setting the maximum current wanted to force on the output in case of a short-circuit condition.

Normally, in case of a short-circuit, the current is set to a higher value in order to fuse, as soon as possible, the cause of the short-circuit, therefore avoiding the rod sticking to the metal piece being welded. This behavior is totally automatic and dynamic, thanks to the signal from the optocoupler previously mentioned. In the case of a short-circuit lasting for more than 2 seconds, the circuit limits the current on the output to a small value, allowing the operator to remove the rod and restart the plasma operation welding. This function can be disabled if some laboratory tests must be carried out without taking into account the right output voltage generated by the system. Connecting pins 15 or 16 of connector J12 to ground the SC_Detection signal is also fixed to ground. In this condition it is simulating that the voltage at the output of the welding machine is at the right level.

Warning: In this case no kind of short-circuit protection or duty cycle limitation is present.


2.8 IGBT or power MOSFET compatibility

From laboratory tests and performance estimates on this application, the switches used on the power section of the asymmetric forward converter can be IGBT or power MOSFET. Only some small modifications to the value of the gate resistor must be carried out when moving from IGBT to power MOSFET use. The demonstration board comes with an IGBT STGW35HF60WD MDMesh™ II family device, and for this reason, on the electric schematic, the graphic symbol is related to this kind of switch.

In terms of power MOSFET, the suggested part to be fitted to the application is the new STW77N65M5 device.

3 Schematics

Figure 3. Power board schematic diagram

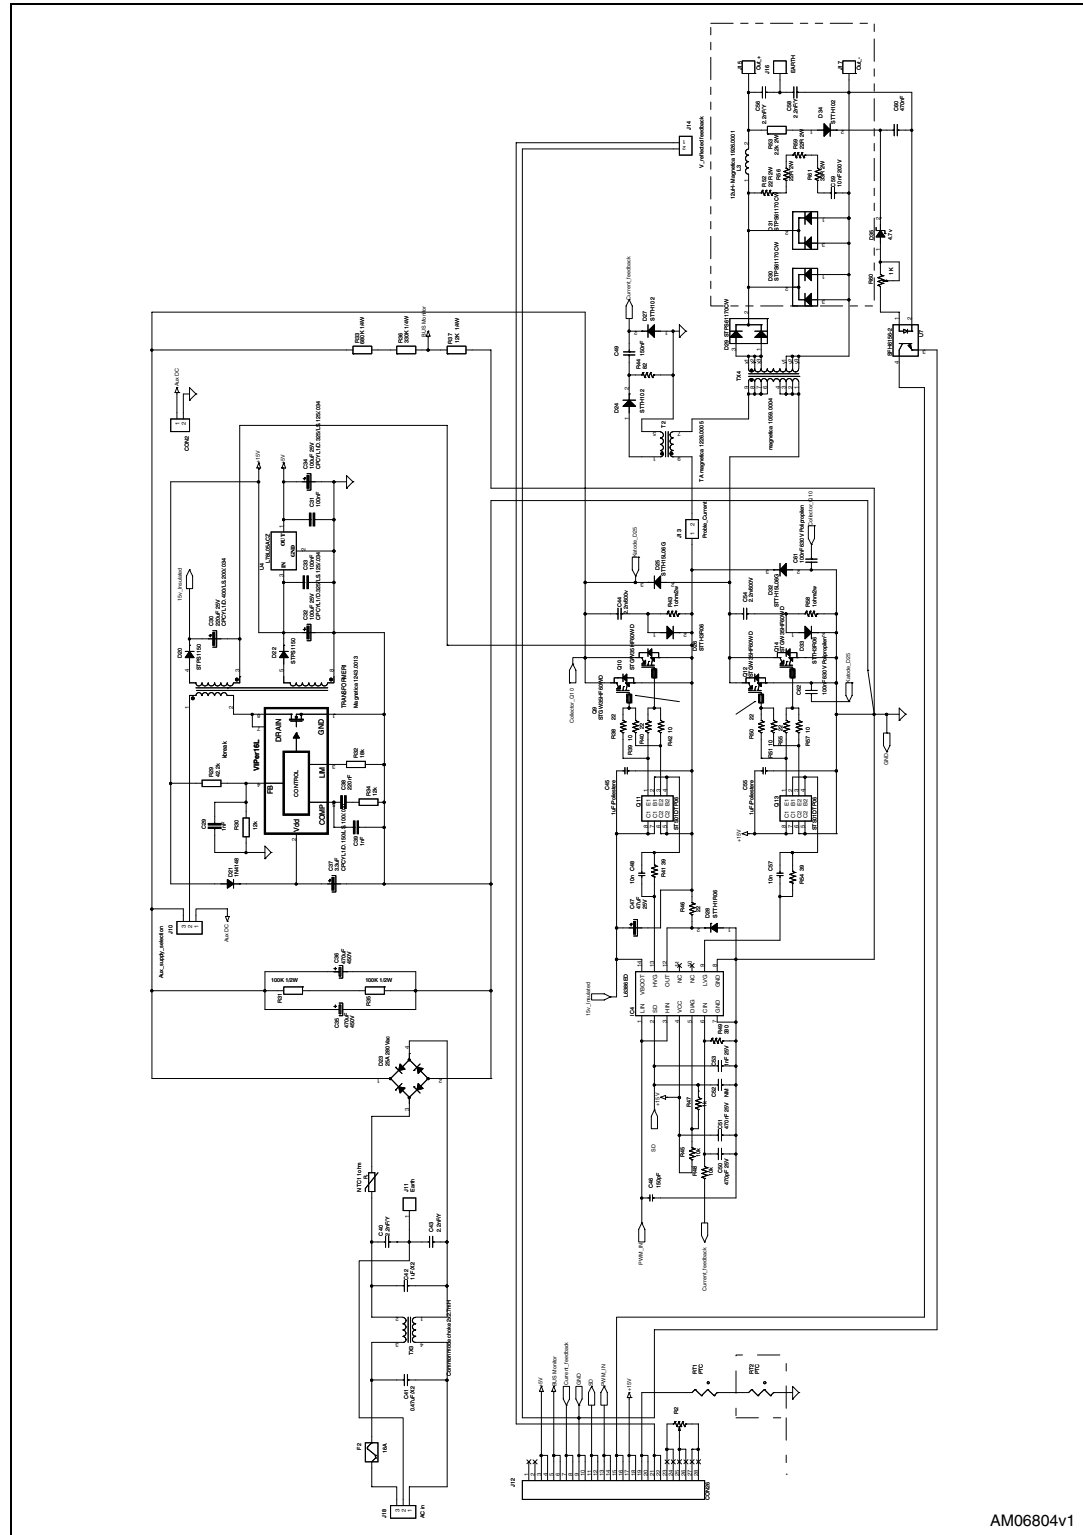

The schematic diagram illustrates the internal circuitry of the AM06805 evaluation board. The central component is the AM06805 IC, which is connected to various external components including resistors, capacitors, and transistors. The board is powered by a +5V supply and has a +15V supply. The schematic includes a detailed view of the IC pins and their connections to the board components. The board is labeled 'AM06805' and 'CON28'.

4 Revision history

Table 1. Document revision history

Date	Revision	Changes
07-Sep-2010	1	Initial release.

Please Read Carefully:

Information in this document is provided solely in connection with ST products. STMicroelectronics NV and its subsidiaries ("ST") reserve the right to make changes, corrections, modifications or improvements, to this document, and the products and services described herein at any time, without notice.

All ST products are sold pursuant to ST's terms and conditions of sale.

Purchasers are solely responsible for the choice, selection and use of the ST products and services described herein, and ST assumes no liability whatsoever relating to the choice, selection or use of the ST products and services described herein.

No license, express or implied, by estoppel or otherwise, to any intellectual property rights is granted under this document. If any part of this document refers to any third party products or services it shall not be deemed a license grant by ST for the use of such third party products or services, or any intellectual property contained therein or considered as a warranty covering the use in any manner whatsoever of such third party products or services or any intellectual property contained therein.

UNLESS OTHERWISE SET FORTH IN ST'S TERMS AND CONDITIONS OF SALE ST DISCLAIMS ANY EXPRESS OR IMPLIED WARRANTY WITH RESPECT TO THE USE AND/OR SALE OF ST PRODUCTS INCLUDING WITHOUT LIMITATION IMPLIED WARRANTIES OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE (AND THEIR EQUIVALENTS UNDER THE LAWS OF ANY JURISDICTION), OR INFRINGEMENT OF ANY PATENT, COPYRIGHT OR OTHER INTELLECTUAL PROPERTY RIGHT.

UNLESS EXPRESSLY APPROVED IN WRITING BY AN AUTHORIZED ST REPRESENTATIVE, ST PRODUCTS ARE NOT RECOMMENDED, AUTHORIZED OR WARRANTED FOR USE IN MILITARY, AIR CRAFT, SPACE, LIFE SAVING, OR LIFE SUSTAINING APPLICATIONS, NOR IN PRODUCTS OR SYSTEMS WHERE FAILURE OR MALFUNCTION MAY RESULT IN PERSONAL INJURY, DEATH, OR SEVERE PROPERTY OR ENVIRONMENTAL DAMAGE. ST PRODUCTS WHICH ARE NOT SPECIFIED AS "AUTOMOTIVE GRADE" MAY ONLY BE USED IN AUTOMOTIVE APPLICATIONS AT USER'S OWN RISK.

Resale of ST products with provisions different from the statements and/or technical features set forth in this document shall immediately void any warranty granted by ST for the ST product or service described herein and shall not create or extend in any manner whatsoever, any liability of ST.

ST and the ST logo are trademarks or registered trademarks of ST in various countries.

Information in this document supersedes and replaces all information previously supplied.

The ST logo is a registered trademark of STMicroelectronics. All other names are the property of their respective owners.

© 2010 STMicroelectronics - All rights reserved

STMicroelectronics group of companies

Australia - Belgium - Brazil - Canada - China - Czech Republic - Finland - France - Germany - Hong Kong - India - Israel - Italy - Japan - Malaysia - Malta - Morocco - Philippines - Singapore - Spain - Sweden - Switzerland - United Kingdom - United States of America

www.st.com